
2009 Buick Allure | Allure, LaCrosse (VIN W) Service Manual | Driver Information and Entertainment | Cellular, Entertainment, and Navigation | Repair Instructions | Document ID: 2103767

Communication Interface Module Replacement



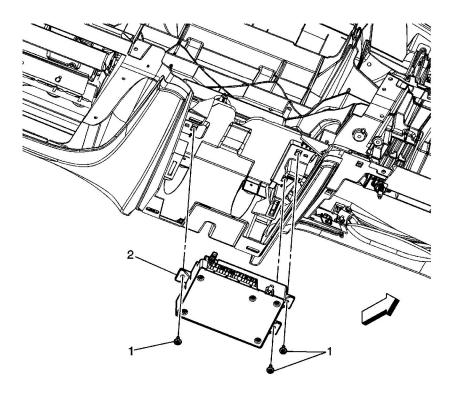

Callout	Component Name
Preliminary Procedure	
Remove the Front Floor Console. Refer to Front Floor Console Replacement	
	Communication Interface Module Bolt (Qty: 3)
1	Caution: Refer to <u>Fastener Caution</u> in the Preface section.
	Tighten 10 N·m (89 lb in)
	Communication Interface Module
	Procedure
2	 Disconnect the electrical connections. If Replacing the Communication Interface Module be sure to transfer Bluetooth Antenna, if equipped. Refer to Control Module References for programming and set up procedures.

© 2012 General Motors Corporation. All rights reserved.