
2009 Buick LaCrosse | Allure, LaCrosse (VIN W) Service Manual | Driver Information and Entertainment |
Cellular, Entertainment, and Navigation | Repair Instructions | Document ID: 2103767

## **Communication Interface Module Replacement**



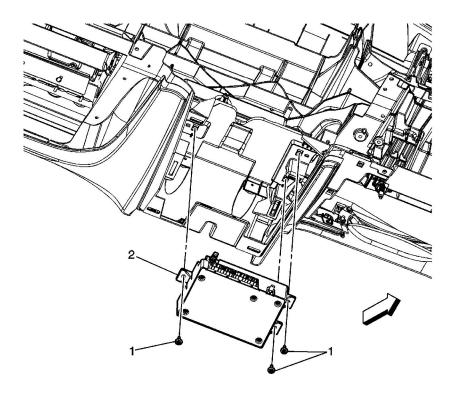

Callout	Component Name
Preliminary Procedure	
Remove the Front Floor Console. Refer to Front Floor Console Replacement	
	Communication Interface Module Bolt (Qty: 3)
1	Caution: Refer to Fastener Caution in the Preface section.
	Tighten 10 N·m (89 lb in)
	Communication Interface Module
	Procedure
2	<ol> <li>Disconnect the electrical connections.</li> <li>If Replacing the Communication Interface Module be sure to transfer Bluetooth Antenna, if equipped.</li> <li>Refer to Control Module References for programming and set up procedures.</li> </ol>

© 2012 General Motors Corporation. All rights reserved.