
2005 Chevrolet Colorado Pickup - 2WD | Canyon, Colorado (VIN S/T) Service Manual | Accessories | Cellular Communication | Repair Instructions | Document ID: 2034009

Communication Interface Module Replacement



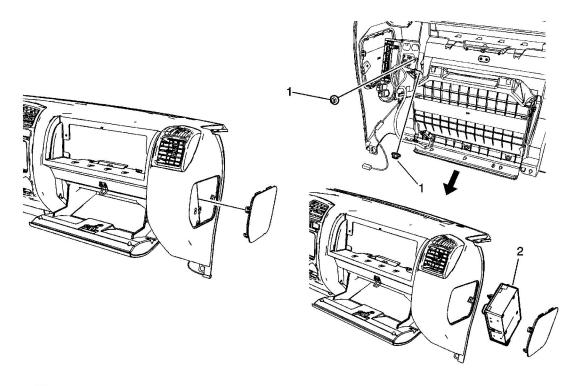

Callout	Component Name
Preliminary Procedures	
	move the service panel located on the right side of the instrument panel (I/P). en the glove compartment assembly past the stops.
1	Communication Interface Module Nut (Qty: 2) Notice: Refer to Fastener Notice in the Preface section. Tighten 9 N·m (80 lb in)
2	Communication Interface Module Procedure
	 Disconnect all electrical connections including the antenna connections. Feed the module through the access hole.

© 2012 General Motors Corporation. All rights reserved.