
Page 1 of 2 **Document ID: 1737752**

> 2007 Chevrolet HHR | HHR (VIN A) Service Manual | Driver Information and Entertainment | Cellular, Entertainment, and Navigation | Repair Instructions | Document ID: 1737752

Communication Interface Module Replacement



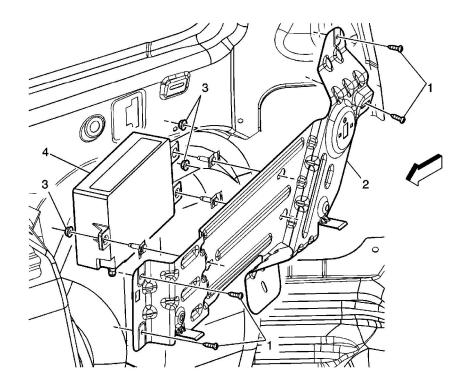

Callout	Component Name
Preliminary Procedures	
2. R€	emove the rear seat. Refer to <u>Rear Seat Replacement</u> . Emove the right rear quarter lower trim panel. Refer to <u>Quarter Lower Rear Trim</u> Inel Replacement.
	Quarter Inner Trim Panel Bracket Screw (Qty: 4)
1	Notice: Refer to <u>Fastener Notice</u> in the Preface section.
	Tighten 10 N·m (89 lb in)
2	Quarter Inner Trim Panel Bracket
	Communication Interface Module Nut (Qty: 3)
3	Tighten 10 N·m (89 lb in)
	Communication Interface Module
	Procedure © 2012 General Motors Corporation. All rights reserved.

Document ID: 1737752 Page 2 of 2

1. Disconnect the electrical connector.

2. Reprogram the communication interface module after installation. Refer to $\underline{\text{Control Module References}} \ .$