
Page 1 of 1 **Document ID: 1993271** 

> 2008 Chevrolet Malibu | Malibu (VIN Z) Service Manual | Driver Information and Entertainment Cellular, Entertainment, and Navigation | Repair Instructions | Document ID: 1993271

## **Communication Interface Module Replacement**

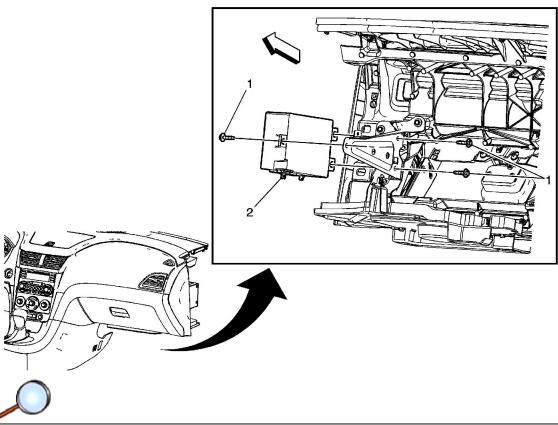

Callout   Component Name	
Preliminary Procedure	
1. Remove Instrument Panel Compartment. Refer to Instrument Panel Compartment	
Replacement.	
2. Release the Glove Box opening stop tabs to allow glove box to rotate fully open for	r
access to fasteners.	
Communication Interface Module Bolt (Qty: 3)	
Notice: Refer to <u>Fastener Notice</u> in the Preface section.	
Tighten	
10 N·m (89 lb in)	
Communication Interface Module	
Procedure	
2 1. Disconnect the electrical connections.	
2. If Replacing the Communication Interface Module be sure to transfer	
Bluetooth Antenna, if equipped.	
3. Refer to <u>Control Module References</u> for programming and set up procedul © 2012 General Motors Corporation. All rights reserved.	es.